


High Speed Drill(2D)

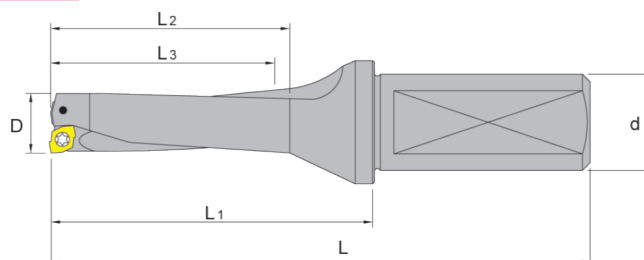

■ For Kyocera Insert

Order number	Insert number	Dimensions (mm)						Screw	Wrench
		D	L	L ₁	L ₂	L ₃	d		
C20 ZC13-26	ZCMT050203	13	95	51	31	26	20	BFTX 0206	TRX06
ZC14-28	ZCMT050203SP	14	97	53	33	28			
ZC15-30	ZCMT050203SU	15	99	55	35	30			
ZC16-32	ZCMT06T204 ZCMT06T204SP ZCMT06T204SU	16	101	57	37	32			
ZC17-34		17	103	59	39	34	25	BFTX 02206	TRX07
C25 ZC18-36		18	117	61	41	36			
ZC19-38		19	119	63	43	38			
ZC20-40		20	121	65	45	40			
C32 ZC21-42	ZCMT080304 ZCMT080304SP ZCMT080304SU	21	123	67	47	42	32	BFTX 02506	TRX08
ZC22-44		22	125	69	49	44			
ZC23-46		23	127	71	51	46			
ZC24-48		24	129	73	53	48			
ZC25-50	ZCMT10T304 ZCMT10T304SP	25	131	75	55	50		BFTX 0410	TRX15
ZC26-52		26	133	77	57	52			
ZC27-54		27	135	79	59	54			
ZC28-56		28	137	81	61	56			
ZC29-58	ZCMT12T306 ZCMT12T304SP	29	139	83	63	58		BFTX 05085	TRX20
ZC30-60		30	141	85	65	60			
ZC31-62		31	143	87	67	62			
ZC32-64		32	145	89	69	64			
ZC33-66		33	147	91	71	66			
ZC34-68		34	149	93	73	68			
ZC35-70		35	151	95	75	70			
ZC36-72		36	153	97	77	72			
ZC37-74	ZCMT150408 ZCMT150406SP	37	155	99	79	74	40	BFTX 05085	TRX20
ZC38-76		38	157	101	81	76			
ZC39-78		39	159	103	83	78			
ZC40-80		40	161	105	85	80			
C40 ZC41-82	ZCMT200608	41	172	107	87	82		BFTX 06012	TRX25
ZC42-84		42	174	109	89	84			
ZC43-86		43	176	111	91	86			
ZC44-88		44	178	113	93	88			
ZC45-90		45	180	115	95	90			
ZC46-92		46	182	117	97	92			
ZC47-94		47	184	119	99	94			
ZC48-96		48	186	121	101	96			
ZC49-98		49	188	123	103	98			
ZC50-100		50	190	125	105	100			
ZC51-102		51	192	127	107	102			
ZC52-104		52	194	129	109	104			
ZC53-106	ZCMT200608	53	196	131	111	106		BFTX 06012	TRX25
ZC54-108		54	198	133	113	108			
ZC55-110		55	200	135	115	110			
ZC56-112		56	202	137	117	112			
ZC57-114		57	204	139	119	114			
ZC58-116		58	206	141	121	116			
ZC59-118		59	208	143	123	118			